


Tap-It®



Available Materials

- Nylon Tap-It body with:
- Carbon steel nail, zinc plated
- Aluminum nail, bulk only

Features/Advantages

- Light to medium loads under dead, variable, or vibratory conditions in solid or hollow base materials
- Specially tempered high strength nylon. Functions in an effective temperature range from -40°F to +170°F
- Quick and easy to install
- Exceptionally resistant to vibration

Approvals/Listings

- G.S.A. Spec FF-S-325C, Group V, Type 2, Class 4


Order Detail

Ultimate Tensile & Shear Loads in Lbs. Concrete Strength (P.S.I.)							
3000 P.S.I.							
Order Code	Hole/Anchor Diameter + Length	Head Style Diameter	Minimum Hole Depth	Minimum Embedment	Tension	Shear	Box Quantity
Flat Head							
5650	1/4 x 1	FLT-7/16	1 1/4"	3/4"	261	884	100
5750	1/4 x 1 1/2	FLT-7/16	1 3/4"	1"	320	920	100
5850	1/4 x 2	FLT-7/16	2 1/4"	1"	325	972	100
Round Head							
4630	3/16 x 1	RND-3/8	1 1/4"	3/4"	283	713	100
4730*	3/16 x 1 1/2	RND-3/8	1 3/4"	1"	335	887	100
5630	1/4 x 1	RND-7/16	1 1/4"	3/4"	261	884	100
5730	1/4 x 1 1/2	RND-7/16	1 3/4"	1"	320	951	100
5830	1/4 x 2	RND-7/16	2 1/4"	1"	325	972	100
Mushroom Head							
4460	3/16 x 3/4	MUSH-9/16	1"	5/8"	283	793	100
4660	3/16 x 1	MUSH-9/16	1 1/4"	3/4"	370	687	100
5460	1/4 x 3/4	MUSH-9/16	1"	5/8"	261	884	100
5660	1/4 x 1	MUSH-9/16	1 1/4"	3/4"	261	884	100
5760	1/4 x 1 1/2	MUSH-9/16	1 3/4"	1"	320	951	100
5860	1/4 x 2	MUSH-9/16	2 1/4"	1"	253	590	100
5160*	1/4 x 3	MUSH-11/16	3 1/4"	1 1/4"	261	884	100
5260*	1/4 x 4	MUSH-11/16	4 1/4"	1 1/4"	261	884	100

*Unassembled

Installation

- 1 Drill hole same diameter as "Tap-It" shell and slightly deeper than fastener length in solid material. Clean hole of debris.
- 2 Insert shell through object to be fastened and into the hole.
- 3 Tap nail until flush with nylon head.

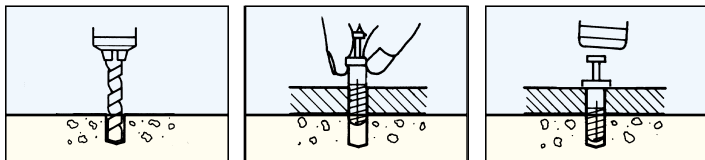

Tap-It®

Nylon Washer

Available Materials

- High strength nylon

Features/Advantages

- Acts as a bearing surface when anchoring through soft material into concrete or other suitable base materials

Installation

- 1 Drill hole same diameter as "Tap-It" shell. Clean hole of debris.
- 2 Insert shell through washer and into object to be fastened, then into the hole.
- 3 Tap nail until flush with nylon head.

Order Detail

Order Code	Hole I.D.	Washer O.D.	Box Quantity
5901	1/4"	1 1/2"	100

